



Symaro™

Duct sensors

QFM41..

for relative humidity and temperature
with calibration certificates

- Operating voltage AC 24 V / DC 13.5...35 V
- Signal output DC 0...10 V / 4...20 mA for relative humidity and temperature
- Very high measuring accuracy throughout the entire measuring range
- Capacitive humidity measurement
- Test function for loop test
- Range of use $-40...+70\text{ °C}$ / 0...100 % r. h.

Use

The QFM41.. sensor is used in ventilation and air conditioning plants requiring:

- Very high accuracy and reliability for measuring relative humidity and temperature
- Examples:
- Storage and production facilities in the paper, textiles, pharmaceutical, chemical, electronics industries, etc.
 - Laboratories
 - Hospitals
 - Computer centers
 - Greenhouses

Type summary

Type reference	Temperature measuring range	Temperature signal output	Humidity measuring range	Humidity signal output	Operating voltage
QFM4101	-	-	0...100 %	active, 4...20 mA	DC 13.5...35 V
QFM4160	0...50 °C, -40...+70 °C or -35...+35 °C	active, DC 0...10 V	0...100 %	active, DC 0...10 V	AC 24 V or DC 13.5...35 V
QFM4171	0...50 °C, -40...+70 °C or -35...+35 °C	active, 4...20 mA	0...100 %	active, 4...20 mA	DC 13.5...35 V

Ordering and delivery

When ordering, please give name and type reference, e.g.:

Room sensor **QFM4160**

Place a separate order for the service set AQF3153 listed under accessories.

The circular connector with its screwed plug is delivered uninstalled.

Equipment combinations

All systems and devices capable of acquiring and handling the sensor's DC 0...10 V or 4...20 mA output signal.

When using the sensors for minimum or maximum selection, for averaging, or to calculate enthalpy, enthalpy difference, absolute humidity, and dew point, we recommend to use the SEZ220 signal converter (see Data Sheet N5146).

Technical design

Relative humidity

The sensor acquires the relative humidity in the air duct via its capacitive humidity sensing element whose capacitance varies as a function of the relative humidity of the ambient air.

An electronic circuit converts the sensor's signal to a continuous DC 0...10 V or 4...20 mA signal, corresponding to a relative humidity of 0...100 % r. h.


Temperature

The sensor acquires the temperature in the air duct via its sensing element whose electrical resistance changes as a function of the temperature.

This variation is converted to an active DC 0...10 V or 4...20 mA output signal, depending on the type of sensor. The output signal corresponds to a selectable temperature range of 0...50 °C, -35...+35 °C or -40...+70 °C.

Load diagram

Output signal, terminal I1 / I2

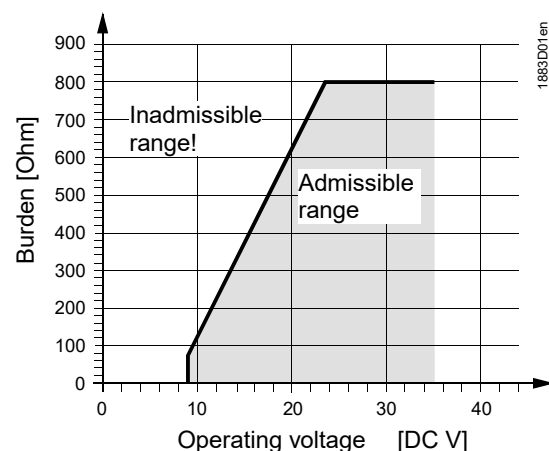

The duct sensor consists of a housing, a printed circuit board, connection terminals, an immersion rod having a measuring tip and a circular connector. The two-part housing comprises a base and screwed removable cover.

A rubber seal is installed between the base and the cover in order to satisfy the requirements of IP 65 degree of protection.

The measuring circuit and the setting element are accommodated on the printed circuit board inside the cover the connection terminals on the base.

The measuring tip is screwed on the immersion rod of the housing.

The sensing elements are located at the end of the measuring tip protected by a screw-on filter cap.

Cable entry is made via the circular connector, which consists of coupling piece with M16 thread and screwed plug. The coupling piece is secured to the housing and internally wired.

Immersion rod and housing are made of plastic and rigidly connected.

The sensor is fitted with the mounting flange supplied with the sensor. The flange is to be placed over the immersion rod and then secured in accordance with the required immersion length.

Setting element

	Test function active			
	U1	U2	I1	I2
	10 V	5 V	20 mA	12 mA
	5 V	10 V	12 mA	20 mA
	0 V	5 V	4 mA	12 mA
	5 V	0 V	12 mA	4 mA

1883Z03en

The setting element is located inside the cover. It consists of 6 pins and a shorting plug. It is used for selecting the required temperature measuring range and for activating the test function.

The different jumper positions have the following meaning:

- *For the active temperature measuring range:*
Jumper in the left position (R1) = $-35\dots+35\text{ }^{\circ}\text{C}$,
Jumper in the mid position (R2) = $0\dots50\text{ }^{\circ}\text{C}$ (factory setting)
Jumper in the right position (R3) = $-40\dots+70\text{ }^{\circ}\text{C}$
- *For the active test function:*
Jumper in the horizontal position: The values available at the signal output are those given in the table “Test function active”

Malfunction

- Should the temperature sensor become faulty a voltage of 0 V (4 mA) will be applied at signal output U2 (I2) after 60 seconds, and the humidity signal at signal output U1 (I1) will reach 10 V (20 mA).
- Should the humidity sensor become faulty a voltage of 10 V (20 mA) will be applied at signal output U1 (I1) after 60 seconds, and the temperature signal will remain active.

Calibration certificates

The sensor and its exchangeable AQF4150 measuring tip are numbered, registered and calibrated prior to delivery. Calibration is traceable to national standards, e.g. METAS, NIST, LNE, PTB. The associated calibration certificates are supplied with the sensor.

Service set AQF3153

The service set comprises three measuring tips without sensor element. Each tip signals a predefined temperature and humidity value to the basic unit:

- 85 % r. h., 40 °C
- 50 % r. h., 23 °C
- 20 % r. h., 5 °C

The fixed values are available at the signal outputs. The accuracy is the same as for the test function. The measuring tips can be exchanged in operation.

The service set allows for easy and quick loop test performance as recommended by Vertical Market Pharma and offered by their calibration service in various countries.

Accessories

<i>Name</i>	<i>Type reference</i>
Measuring tip certified (exchangeable)	AQF4150
Service set (for loop test)	AQF3153
Filter cap (for replacement)	AQF3101, AQF3102, AQF3103
3 m cable for remote measurement	AQY2010

Engineering notes

	<p>A transformer for safety extra low-voltage (SELV) with separate windings for 100 % duty is required to power the sensor. When sizing and protecting the transformer, the local safety regulations must be complied with.</p> <p>When sizing the transformer, the power consumption of the duct sensor must be taken into consideration.</p> <p>For correct wiring of the sensor, refer to the Data Sheets of the devices with which the sensor is used.</p> <p>The permissible line lengths must be considered.</p>
Cable routing and cable selection	<p>It must be considered for routing of cables that the longer the cables run side by side and the smaller the distance between them, the greater the electrical interference. Shielded cables must be used in environments with EMC problems.</p> <p>Twisted pair cables are required for the secondary supply lines and the signal lines.</p>
Note to QFM4171	<p>Terminals G1(+) and I1(–) for the humidity output must always be connected to power, even if only terminals G2(+) and I2(–) of the temperature output are used!</p>

Mounting notes

Location	<p>Mount the sensor in the center of the duct wall. If used together with steam humidifiers, the minimum distance after the humidifier must be 3 m to max 10 m.</p> <p>Fit the sensor in the extract air duct if the application involves dew point shifting.</p> <p>Fit only the flange to the duct wall. The sensor is then inserted through the flange and engaged.</p>
Caution!	<ul style="list-style-type: none">• The seal between base and cover must not be removed, or else degree of protection IP 65 will be no longer ensured.• The sensing elements inside the measuring tip are sensitive to impact. Avoid any such impact on mounting.
Mounting instructions	<p>Mounting Instructions are printed on the inner side of the package.</p>

Commissioning notes



Check wiring before switching on power. The temperature measuring range must be selected on the sensor, if required.

Wiring and the output signals can be checked by making use of the test function (refer to "Mechanical design").

We recommend not to use voltmeters or ohmmeters directly at the sensing element. In the case of the simulated passive output signals, measurements with commercially available meters cannot be made (measuring current too small).

Disposal



This symbol or any other national label indicate that the product, its packaging, and, where applicable, any batteries may not be disposed of as domestic waste. Delete all personal data and dispose of the item(s) at separate collection and recycling facilities in accordance with local and national legislation.

For additional details, refer to www.siemens.com/bt/disposal.



Technical data

Power supply	Operating voltage	AC 24 V \pm 20 % or DC 13,5...35 V (SELV) or AC/DC 24 V class 2 (US)
	Frequency	50/60 Hz at AC 24 V
	Power consumption	\leq 1 VA
	External supply line protection	Fuse slow max. 10 A or Circuit breaker max. 13 A Characteristic B, C, D according to or Power source with current limitation of max. 10 A
	Cable lengths for the measuring signal	Max. perm. cable lengths refer to Data Sheet of the device handling the signal
Functional data "Humidity sensor"	Measuring range	0...100 % r.h.
	Measuring accuracy at 23 °C and AC/DC 24 V in 0...100 % r.h.	\pm 2 % r.h.
	Temperature dependency	\leq 0.05 % r.h./°C
	Time constant	< 20 s
	Supply air velocity	20 m/s
	Long-term drift	< 1 % r.h./year
	Output signal, linear (terminal U1)	DC 0...10 V $\hat{=}$ 0...100 % r.h., 1 mA max.
	Output signal, linear (terminal I1) Burden	4...20 mA $\hat{=}$ 0...100 % r.h. refer to "Function"
	Measuring range	0...50 °C (R2 = factory setting), –35...+35 °C (R1), –40...+70 °C (R3)
	Sensing element	Pt 1000
Functional data "Temperature sensor"	Measuring accuracy at AC/DC 24 V in 23 °C 15...35 °C –35...+70 °C	\pm 0.3 K \pm 0.6 K \pm 0.8 K
	Time constant	< 3.5 min. in with 2 m/s moved air
	Output signal, linear (terminal U2)	DC 0...10 V $\hat{=}$ 0...50/–35...+35/–40...+70 °C max. 1 mA
	Output signal, linear (terminal I2) Burden	4...20 mA $\hat{=}$ 0...50/–35...+35/–40...+70 °C refer to "Function"
	Protection class	III according to EN 60730-1
	Protection degree of housing	IP65 according to EN 60529 in the built-in state
	Connector with screwed plug Screw terminals for Cable entry	Lumberg RSC 4/9 0.75 mm ² max. 4...8 mm dia.
Electrical connections	Operation to Climatic conditions Temperature (housing with electronics) Humidity Mechanical conditions	class 4K2 to IEC 60 721-3-4 –40...+70 °C 0...100 % r. h. (with condensation) class 3M2 to IEC 60 721-3-3
	Transport to Climatic condition Temperature Humidity Mechanical conditions	IEC 60721-3-2 class 2K3 –40...+70 °C < 95 % r.h. class 2M2
	Base	polycarbonate, RAL 7001 (silver-grey)
	Cover	polycarbonate, RAL 7035 (light-grey)
	Immersion rod	polycarbonate, RAL 7001 (silver-grey)
Environmental conditions	Filter cap AQF3101	Body: polycarbonate, RAL 7001 (silver-grey) Filter: PTFE membrane (white)
	AQF3102	PTFE sintered catalytic filter for H ₂ O ₂ environment
	AQF3103	sintered stainless steel to DIN 17440
	Mounting flange	PA66 – GF35 (black)
Materials and colors		

Directives and Standards	Circular connector	
	Connector with screwed plug	Lumberg RSC 4/9
	Contact carrier and body	PA, black
	Knurled nut and contact	CuZn, nickel-plated
	Coupling piece	Lumberg RKFM 4/0,5 M
	Contact carrier	TPU
	Casing and contact	CuZn, nickel-plated
	Sensor (complete assembly)	silicon-free
	Packaging	corrugated cardboard
	Product standard	EN 60730-1
Environmental compatibility	Electromagnetic compatibility (Applications)	Automatic electrical controls for household and similar use
	EU Conformity (CE)	For use in residential, commerce, light-industrial and industrial environments
	RCM Conformity	CE1T1883xx ^{*)}
	UL	CE1T1864en_C1 ^{*)}
Weight	UL	UL 873, http://ul.com/database
	The product environmental declaration CE1E1882 ^{*)} contains data on environmentally compatible product design and assessments (RoHS compliance, materials composition, packaging, environmental benefit, disposal).	
	Incl. packaging	0.244 kg
	AQF3153	0.066 kg
	AQF4150	0,050 kg
*) The documents can be downloaded from http://siemens.com/bt/download .		



Connection terminals

QFM4160

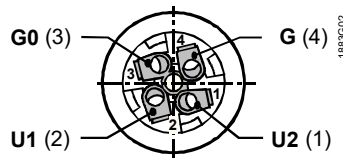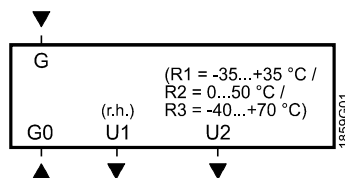

Front view:
Connector fitted,
body removed

QFM4101, QFM4171

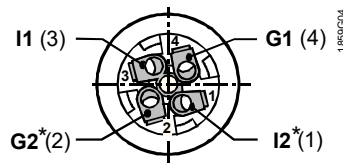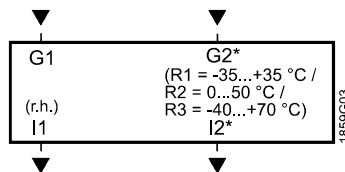

Front view:
Connector fitted,
body removed


* G2, I2 Only with QFM4171.

G, G0	Operating voltage AC 24 V (SELV) or DC 13.5...35 V
G1, G2	Operating voltage DC 13.5...35 V
U1	Signal output DC 0...10 V for relative humidity 0...100 %
U2	Signal output DC 0...10 V for temperature range 0...50 °C (R2 = Werkeinstellung), -35...+35 °C (R1) oder -40...+70 °C (R3)
I1	Signal output 4...20 mA for relative humidity 0...100 %
I2	Signal output 4...20 mA for temperature range 0...50 °C (R2 = Werkeinstellung), -35...+35 °C (R1) oder -40...+70 °C (R3)

Note on connection terminals of the QFM4171:

Terminals G1(+) and I1(-) for the humidity output must always be connected to power, even if only the temperature output G2(+) and I2(-) is used!

Dimensions

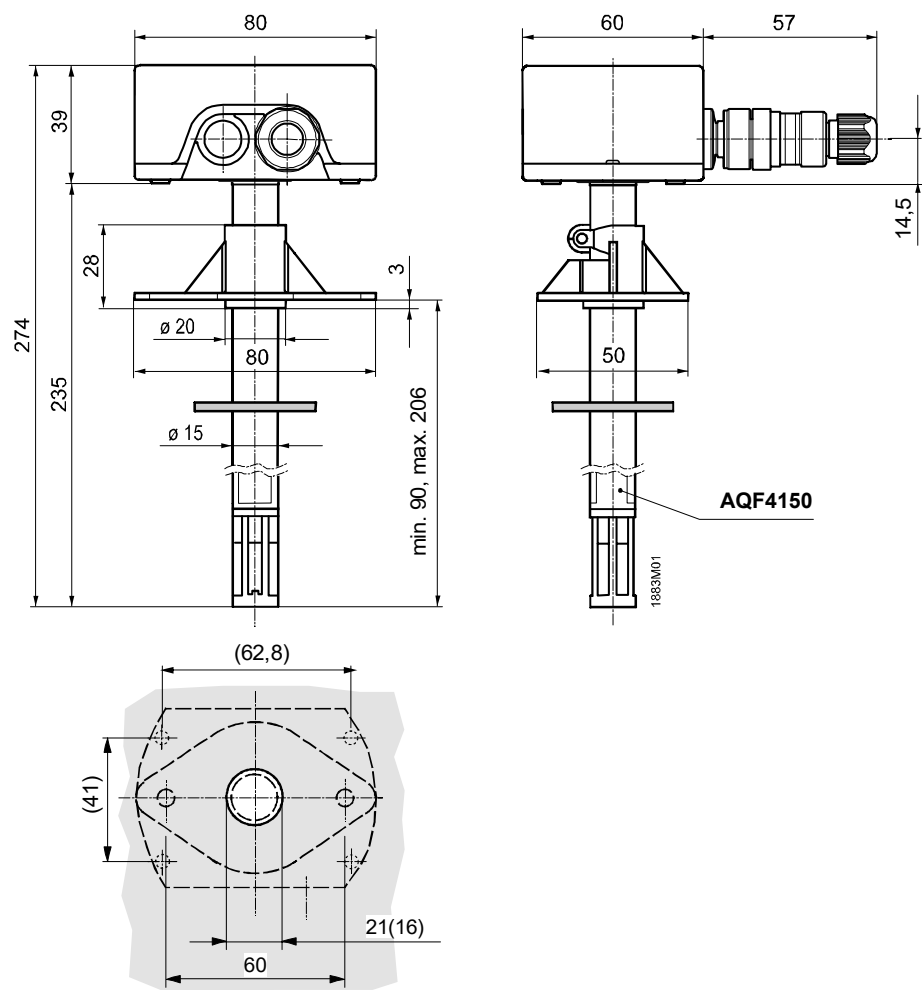

Drilling template with (without) mounting flange

Dimensions in mm

Issued by
Siemens Switzerland Ltd
Smart Infrastructure
Global Headquarters
Theilerstrasse 1a
CH-6300 Zug
Tel. +41 58 724 2424
www.siemens.com/buildingtechnologies

© Siemens Switzerland Ltd 2006
Technical specifications and availability subject to change without notice.